<u>.</u> 	FILE INFO		•		SECRET)	,	
'	4 Jun 70 7 6	570	1	REPRODUC	TION PRO	HIBITED	4 Jun 70 21	5 1
	ACTION	1	IDEA	6	37	11	16	
		2	11	7	M	12	17	
L		3	DOPS	8	//	13	18	
L		4	125/4	9		14	19	
		5	SAS	1Ø		15	20	
, [X1 . 6	MNCECPE		SAK	1Ø		15	20	

Approved For Felease 2092/96/12 5 GH2 SDR 24B0044ZR000200020018-0

IDEALIST

SUBJ: AIRCRAFT INCIDENT REPORT. MSG 2

25X1AEF: A. B.

DATED 3 JUNE 1970.

- A. A BOARD OF INVESTIGATION HAS BEEN CONVENED TO DETERMINE
- THE CAUSE OF THE RECENT I-33 INCIDENT AND TO RECOMMEND ACTION
 TO PREVENT RECURRENCE. INVESTIGATING OFFICERS APPOINTED ARE:
 LT COL RONALD LEGNER AND MAJOR REX HARGIS.
 - B. FOLLOWING IS ADDITIONAL INFORMATION ON THE INCIDENT:
 REFERENCE IS AFR 127-4 FORMAT. INFORMATION IN THOSE PARAGRAPHS
 NOT LISTED IS UNCHANGED.
 - 5. APPROXIMATELY 16 MAN-HOURS WILL BE REQUIRED TO REPAIR AIRCRAFT. DAMAGES: RT OUTER GEAR DOOR SHEET METAL

 DAMAGE.

REAR ATTACHING BOLT FOR RT GEAR DOOR - BROKEN.

RT TIP TANK - SKIN BENT.

RT LANDING SEAR, WHEEL, TIRE, AND

FILE INFO	•	SECF (When File			
		REPRODUCTION	PROHIBITED		
ACTION	1	6	11	16	
	2	7	12	17	
	3	8	13	18	
\	4	9	14	19	
	5	1Ø	15	20	

BRAKE - PROBABLE DAMAGE.

9. AIRCRAFT WAS FLYING LOCAL AREA INSTRUMENT TRAINING MIS
111 SION. PRIOR TO THE INCIDENT, AIRCREW HAD FLOWN TACAN-ILS LOW

25X1A

APPROACH AT FOLLOWED BY SEVERAL TOUCH AND GO LANDINGS

25X1A

ONE OF THE PILOTS FLEW THE AIRCRAFT EARLIER IN THE

DAY AND HAD NO PROBLEM WITH ANY OF ITS SYSTEMS.

- IG. IT WAS NOTED DURING THE LOW PASSES PRIOR TO FINAL LANDING THAT THE RIGHT MAIN GEAR OUTER DOOR WAS NOT PROPERLY IN PLACE.

 PRELIMINARY FEELING IS THAT MATERIEL FAILURE OF DOOR CAUSED IT TO
 LODGE BETWEEN GEAR WELL AND GEAR, RESTRICTING GEAR FROM FULL DOWN
 AND LOCKED TRAVEL. THE TWO OTHER T-33 AIRCRAFT WERE INSPECTED NOTHING UNUSUAL REVEALED.
- C. THIS IS FINAL MESSAGE. COPIES OF INFORMAL INVESTIGATION WILL BE FORWARDED.

HISECRET

BT

Approved Fo	**************************************	47 R0002000 0018-0	A J
	SECRET		
	(When Filled In)		10.1
162	DEBDODUCTION DROUBLED	3 1 70 90 2.0	

	FILE INFO			(When Filled In)		10.1
.1	3 Jun 70 7 6 4	62	REPRO	DOUCTION PROHIBITE	D 3 Jun 70 20	28
1	ACTION	1	6	11	1	6
-		2	7	12	1	7
		3	8	13	1	8
		4	9	14	1	9
		5	10	15	12	Ø

25X1A 25X1A E C R E T 032005Z JUN 70 CITE 440

NGR pape

SUBJECT: AIRCRAFT INCIDENT REPORT

25X1 REFERENCE

1. IAW AFR 127-4, ATTACHMENT 7 THE

FOLLOWING INCIDENT REPORT IS

SUBMITTED.

- 1. JA JUN 1976/1918Z
- 2. EDWARDS AFB (LAKEBED)
- 3. T-33A/53-58#9
- 4. EDWARDS AFB
- 5. MINOR INCIDENT/MAN HOURSDAWILL FOLLOW BY SEPARATE MESSAGE.

25X1A 6. ______ CP

NO INJURY TO EITHER PILOT

- 7. N/A
- 8. N/A
- 9. T-33/VFR/1747Z/EDWARDS AFB

I PLUS 31

	sub parac 1	thu
17.		25X10

, separate

NCE COPY

Approved For Belease 2003/96/18 ; CIA-SDRZ4B00447R000200020018-0

S	E	C	R	ET
---	---	---	---	----

(When Filled In) FILE INFO

REPRODUCTION PROHIBITED							
ACTION	1	6	11	16			
	2	7	12	17			
	3	8	13	18			
1	4	9	14	19			
	5	1Ø	15	20			
	ACTION	ACTION 1 2 3 4 5 5	ACTION 1 6 7	ACTION 1 6 11 2 3 12 3 8 13 4 9 14 5 16 15	ACTION 1 6 11 16 16 17 17 18 18 18 19 14 19 19 16 17 18 18 18 19 10 15 1		

PAGE 2 5449 S E C R E T

10. LANDING

PRIOR TO NORMAL LANDING 11.

NORTH BASE, PILOT FOUND

RIGHT MAIN GEAR UNSAFE

CONDITION. ALL EMERGENCY

PROCEDURES FAILED TO

PROFIDE SAFE GEAR INDICATION.

NORTH BASE MOBIL CONFIRMED

RIGHT MAIN GEAR COCKED

INBOARD APPROXIMATELY

20 DEGREES.

LAKEBED LANDING ACCOMPLISHED. DURING

ROLL-OUT AT APPROXIMATELY

30 KNOTS RIGHT MAIN GEAR

COLLAPSED AND THE AIRCRAFT

SLOWLY GROUND-LOOPED TO

THE RIGHT STOPPING 180 DEGREES

FROM THE DIRECTION OF LANDING.

BRAKES NOT USED DURING

ROLL-OUT. BOTH PILOTS EVACUATED

CECDET

J	LUI		
(When	Fil	led	In)

١.	FILE INFO	- Market - M	(When Fill	led In)		
ر زاران د زاران			REPRODUCTION	PROHIBITED		
N. J.	ACTION	11	6	[11]	16	1
-		2	7	12	17	
		3	8	13	18	
25X1	Α	4	9	14	19	
		5	1Ø	15	20	

PAGE 3 5448 S E C R E T

NOR PARE AIRCRAFT WITHOUT

INJURY. ONLY APPARENT DAMAGE THIS

TIME: RIGHT MAIN GEAR DOOR AND RIGHT TIP TANK.

EDWARDS AFB LOCAL WEATHER OBSERVATION

3 JUNE 1970 1920Z (1220 PDT)

"18,666 FT SCATTERED ESTIMATED 23,666 FT.

OVERCAST VISIBILITY 35 STATUTE MILES.

TEMPERATURE 92 DEGREES F., DEWPOINT 33 DEGREES F.,

SURFACE WIND CALM. ALTIMETER SETTING

29.93 INCHES."

REMARKS: "SMALL CUMULUS WEST THROUGH

NORTH, TOWERING CUMULUS BUILDING

WEST-NORTHWEST, LOWER ALTO-CUMULUS

SOUTH-THROUGH WEST THROUGH NORTH AT

11 15,000 FT, BREAK IN OVERCAST, WIND

DRIN VRBL.

13. UNKNOWN AT THIS TIME; WILL

FORWARD WHEN AVAILABLE.

14. UNKNOWN

15. N/A

	SECRET
FILE INFO	(When Filled In)

-	REPRODUCTION PROHIBITED							
	ACTION	1	6	[11]	16			
—		2	7	12	17			
		3	8	13	18			
2 <u>5</u> X1/		4	9	14	19			
250 17		5	10	15	20			

PAGE 4 5440 SECRET

NCR paper

16. BY SEPARATE MESSAGE.

2**5**X1A

17.

SECRET

BT